

SERVICE ACTION RECALL		
To: For the attention of: Please copy to:	All Dealers / MEAM The Dealer Principal The Service Manager The Sales Manager The Parts Manager Warranty Administrator Aston Martin Technician(s)	Reference: SAR 011 Issued: November 2005
Model:	DB9	
Vin Range:	A04048 – B04296 – See attached VIN list	
Subject:	ZF Automatic Transmission –Parking Pawl Glide Plate	Page: 1 of 7

Dear Sirs,

Aston Martin is requesting that franchised Dealers contact immediately the owners of vehicles within the above VIN range, as vehicles may have been fitted with an automatic transmission (parking pawl glide plate) which may not have been hardened as a result of improper material handling during the manufacturing process. In order to correct this manufacturing error, the parking pawl glide plate should be replaced with a new plate.

Communications:

 
Aston Martin Lagonda Limited will be mailing a letter directly to all UK and North America owners advising them of this Service Action Recall.

* In all other markets however, owing to the difficulty of obtaining accurate current owner registration details, this mailing activity **will be the Dealer's responsibility**. A suggested letter format is attached for use in this regard within this SAR011 documentation.

Administration: All Dealers should also be aware that certain vehicles within the listed VIN range may also be affected by previously announced Field Service Actions; therefore should plan their actions to avoid customers having to make separate visits to the Dealership. Outstanding status for all affected vehicles can be found using the Field Service Action On-Line Enquiry Screen, available on the ODW Warranty System for each VIN.

If you have any queries in connection with any aspect of this Service Action Recall, please contact Aston Martin Customer Service on: +44 (0)1926 644744/5/6, or facsimile: +44 (0)1926 644733, or your Regional After Sales Manager. Should you receive any enquiries from members of the Press, may I recommend that you refer them to Aston Martin Brand Communications, on: +44 (0)1926 644851. Thank you for your support and co-operation in this matter.

Yours faithfully



Chris E Baker
General Manager, After Sales Operations

Encl: SAR 011 Documentation

*Suggested Letter format, applicable to all Dealers except UK & North America

SERVICE ACTION RECALL		
To:	All Dealers / MEAM	Reference: SAR 011 Issued: November 2005
For the attention of:	The Dealer Principal	
Please copy to:	The Service Manager The Sales Manager The Parts Manager Warranty Administrator Aston Martin Technician(s)	
Model:	DB9	
Vin Range:	A04048 – B04296 – See attached VIN list	Page: 1 of 7
Subject:	ZF Automatic Transmission –Parking Pawl Glide Plate	

Following field investigations, it has been identified that a number of Aston Martin DB9 models have been assembled with an automatic transmission (parking pawl glide plate) that may not have been subjected to the required heat treatment process and therefore is not hardened correctly. Consequently, Park may not engage even if the park button in the vehicle is pressed to select Park and all driver indicators show the Park position has been achieved.

These vehicles should therefore be modified and have a new parking pawl glide plate installed into the vehicle at the earliest opportunity. In order to rectify this manufacturing error on DB9, we are issuing Service Action Recall SAR 011.

Service Reception Desk - Essential Vehicle Pre Booking-in Checks

Before taking further action, immediately log onto the ODW Warranty System, select the Warranty Live screen (Outstanding Campaigns Status), and using the VIN list range provided, check individual VIN's under your control to determine whether any FSA or SAR remains open, including this issue. List them all and plan accordingly.

As the OWD Warranty System operates in real time, the On-Line status reflects the most recent Dealer Warranty Claim submissions status.

Always complete this check in advance to pre-secure Parts availability, thus avoiding vehicle downtime and customer inconvenience. If necessary, contact our Warranty Department (quoting SAR 011) for clarification prior to commencing with the following instructions.

Tel:-0044 (0) 1926 644708

Fax:-0044 (0) 1926 644733


Workshop procedure

With the vehicle in the workshop and the body protection kit fitted, proceed as follows:

- Ensure the vehicle is cold and the gearbox oil temperature is below 50°C (122°F)
- Place the vehicle on a wheels free ramp, remove the LH rear seat base, and engage the Park Release Lever
- Elevate the vehicle and remove the rear undertray
- Remove the rear sub-frame cross-member
- Remove the left-hand rear exhaust pipe

- Disconnect the oil cooler pipes from the gearbox at the thermostat and remove the pipework/thermostat assembly
- Drain the gearbox oil into a clean container for re-use, and refit the drain plug
- Remove the gearbox oil pan
- Locate and remove the Park Pawl Guide Plate by removing the four Torx screws and ease the old plate out of the gearbox, (see figure 1). Retain the displaced part for warranty return

Figure 1

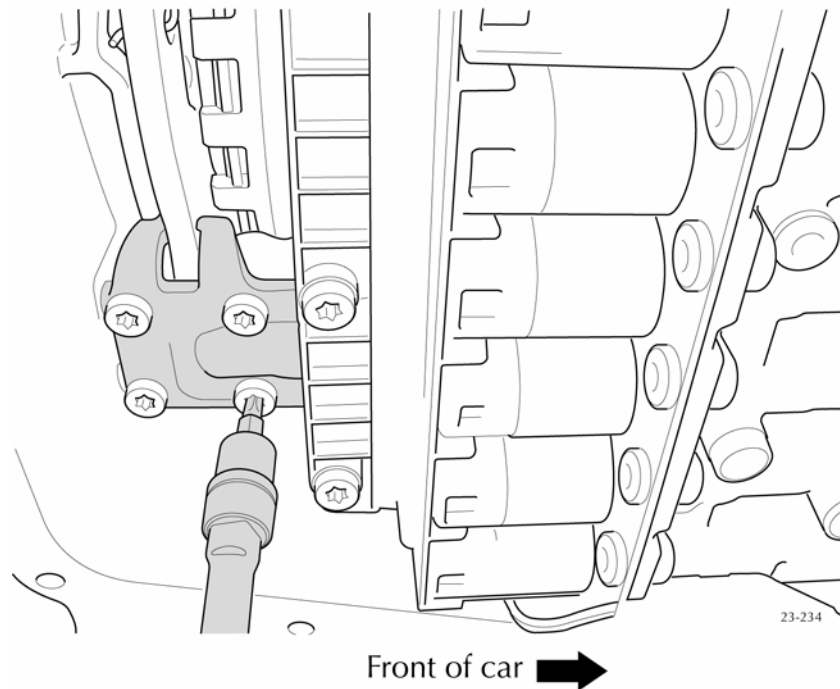

- Fit the new Park Pawl Guide Plate and tighten the four Torx screws to 10Nm
- Check the park pawl is free to move
- Refit the gearbox oil pan, (confirm that the original gasket is clean and fully seated before refitting the gearbox oil pan) and cross torque all screws to 7-9Nm
- Refit the oil cooler pipes and thermostat assembly
- Refit the left-hand exhaust pipe
- Refit the rear sub-frame cross-member and torque the bolts to 85Nm
- Refill the gearbox with the oil that was removed previously, using a syringe
- Disengage the park release lever and refit the LH rear seat base
- Carry out gearbox oil level check as stated in Aston Martin DB9 Work-Shop Manual, Transmission section (07.00 page 1-4) and top up as required
- Remove the vehicle from the ramp and remove the vehicle protection kit
- After the repair has been completed, please check that on a suitable incline the vehicle is held stationary by the transmission alone with Park selected

Warranty Information

<u>Tier Ref</u>	<u>VIN</u>	<u>Labour</u>	<u>Part Number</u>	<u>Description</u>	<u>Qty</u>
A	A04048 – B04296	1.5 hrs	4G43-42-10345	Parking Pawl Glide Plate	1

Please note:- All displaced Parking Pawl Glide Plates are required to be sent back to Parts Operations with the relevant VIN information through the normal warranty parts return process.

On completion of this Service Action Recall, please ensure that the record section of the Vehicle Owner's Guide is updated to reflect the completion of this instruction. Any vehicles under your control and any other unmodified retailed vehicle within the affected VIN range that subsequently pass through your workshops must be modified at the earliest opportunity.

Be aware that certain vehicles within the listed VIN ranges may be affected by previously announced Field Service Actions; therefore you should plan your actions so as to avoid customers having to make separate visits to the Dealership.

If you have any queries in connection with any aspect of this Service Action Recall please contact Aston Martin Technical Services on +44 (0) 1926 644700/2/3 or facsimile: +44 (0) 1926 644733. e-mail: stiltma1@astonmartin.com, dhende17@astonmartin.com, nhunter3@astonmartin.com,

Alternatively, please contact your Regional After Sales Manager.

Thank you for your co-operation in this matter.



Draft Letter from Dealer to Customer – All non UK/NA Markets

Customer Name, Address

Vehicle full VIN:

Registration Number:

Dear

DB9 - Service Action Recall (SAR011) - ZF - Automatic Transmission Parking Pawl Guide Plate

Aston Martin and our franchised Dealers continually strive to achieve and maintain the highest standards of product quality, service and customer satisfaction.

As part of the continuing quality reviews conducted by Aston Martin, it has been identified that on certain DB9 vehicles, when a load is applied on the parking interlock system, the locking cone which is part of the parking pawl system may create an indentation on an unhardened guide plate at the cone contact area. An indentation may also result in a raised edge towards the locking cone guide channel, which may hinder the locking cone from reaching its end position.

Park may not therefore engage when the "P" button in the vehicle is pressed to select Park, even though all driver indicators show the Park position has been achieved. This could result in a vehicle roll-away condition increasing the risk of a crash, unless the parking brake is applied.

The inspection and modification will take a maximum of 1.5 hours and naturally this work will be carried out completely free of charge.

In the interests of safety, durability and reliability it is important that this modification is completed at the earliest possible opportunity, so I would ask you to contact us as soon as possible.

To make an appointment or to request more information about Service Action Recall (SAR011), please contact our Customer Reception Desk on Tel: xxxx-xxxxxx. If however you are no longer the owner of this vehicle, please let us know and we'll make every effort to contact the new owner.

We apologise for any inconvenience this matter may cause you and thank you for your patience and co-operation in helping us eliminate this potential concern at the earliest opportunity. Thank you

Yours sincerely,

Dealer Service Manager

Affected VIN List

A04314	Australia	SILVERSTONE ASTON MARTIN
B04215	Canada	MCL MOTOR CARS (1992) INC173
A04297	France	AUTO PERFORMANCE

A04212	Germany	PREMIUM CARS PETERSGMBH&CO KG
A04233	Germany	PREMIUM CARS PETERSGMBH&CO KG
B04296	Italy	J GROUP S.R.L.
A04213	Japan	ASTON MARTIN AKASAKA
A04229	Japan	ASTON MARTIN AKASAKA
A04230	Japan	ATLANTIC CARS LTD
B04258	Japan	ATLANTIC CARS LTD
A04313	Japan	ATLANTIC CARS LTD
B04288	Lebanon	MANA AUTOMOTIVE S.A.L
A04142	Middle East	AL HABTOOR MOTORS (LLC)
A04248	Middle East	MIDDLE EAST ASTON MARTIN
A04246	New Zealand	BRITISH VEHICLE IMPORTERS LT
A04231	Norway	AS INSIGNIA
A04243	UK	GRANGE MOTORS - WEL.GDN.CITY
A04247	UK	JCT 600
A04307	UK	BROUGHTONS ASTON MARTIN

B04060	USA	ASTON MARTIN MARIN
B04045	USA	BAUER ASTON MARTIN
A04055	USA	SILVER STATE FORD
B04061	USA	BAUER ASTON MARTIN
B04047	USA	COLE EUROPEAN
B04064	USA	CUSH ASTON MARTIN
A04048	USA	STAR MOTOR CARS
A04057	USA	ASTON MARTIN OF TAMPA BAY
B04051	USA	BAUER ASTON MARTIN
B04073	USA	BAUER ASTON MARTIN
B04074	USA	BAUER ASTON MARTIN
B04054	USA	BAUER ASTON MARTIN
B04075	USA	DESERT EUROPEAN MOTORCARS LT
B04066	USA	DESERT EUROPEAN MOTORCARS LT
B04067	USA	DESERT EUROPEAN MOTORCARS LT
A04076	USA	ASTON MARTIN OF NEW ENGLAND
A04070	USA	ASTON MARTIN OF NEW ENGLAND
B04088	USA	DESERT EUROPEAN MOTORCARS LT
B04098	USA	DESERT EUROPEAN MOTORCARS LT
B04077	USA	DESERT EUROPEAN MOTORCARS LT
B04071	USA	DESERT EUROPEAN MOTORCARS LT
A04100	USA	ASTON MARTIN OF CLEVELAND
A04079	USA	ASTON MARTIN OF CLEVELAND
A04096	USA	ASTON MARTIN OF CLEVELAND
B04129	USA	SILVER STATE FORD

B04097	USA	DESERT EUROPEAN MOTORCARS LT
B04131	USA	JOHN EAGLE ASTON MARTIN
B04137	USA	SILL-TERHAR ASTON MARTIN
B04123	USA	SILL-TERHAR ASTON MARTIN
B04241	USA	ASTON MARTIN BEVERLY HILLS
B04242	USA	ASTON MARTIN BEVERLY HILLS
B04291	USA	ASTON MARTIN SILICON VALLEY
A04134	USA	SCOTTSDALE AML (N/A)
A04125	USA	JOHN EAGLE ASTON MARTIN
A04167	USA	THE COLLECTION
A04161	USA	FOREIGN CARS ASTON MARTIN
B04122	USA	SILL-TERHAR ASTON MARTIN
B04124	USA	JOHN EAGLE ASTON MARTIN
B04120	USA	JOHN EAGLE ASTON MARTIN
B04119	USA	JOHN EAGLE ASTON MARTIN
A04173	USA	MILLER MOTORCARS ASTON MARTI
B04127	USA	JOHN EAGLE ASTON MARTIN
B04136	USA	JOHN EAGLE ASTON MARTIN
B04121	USA	STAR MOTOR CARS
B04143	USA	STAR MOTOR CARS
B04135	USA	ASTON MARTIN OF TAMPA BAY
A04189	USA	RAY CATENA ASTON MARTIN
B04164	USA	JOHN EAGLE ASTON MARTIN
B04139	USA	JOHN EAGLE ASTON MARTIN
B04160	USA	JOHN EAGLE ASTON MARTIN
B04154	USA	JOHN EAGLE ASTON MARTIN
B04166	USA	JOHN EAGLE ASTON MARTIN
B04141	USA	JOHN EAGLE ASTON MARTIN
B04156	USA	PALM BEACH MOTOR CARS LTD
B04165	USA	MILLER MOTORCARS ASTON MARTI
B04200	USA	ASTON MARTIN LAGONDA OF TROY
B04188	USA	THE COLLECTION
B04190	USA	THE COLLECTION
B04234	USA	MID WESTERN AUTO GROUP
B04245	USA	MILLER MOTORCARS ASTON MARTI
B04240	USA	MOORE AUTOMOTIVE GROUP
B04249	USA	FOREIGN CARS ASTON MARTIN
B04294	USA	ASTON MARTIN TYSONS
B04254	USA	RAY CATENA ASTON MARTIN
B04514	USA	STAR MOTOR CARS
B04519	USA	ATLANTA
B04518	USA	STAR MOTOR CARS

